


Instruction

Preparing tool 74_Z-0-12-18 for 1/2" annular plenum cables

Safety Instructions



Insertion / Replacement of Blade Unit

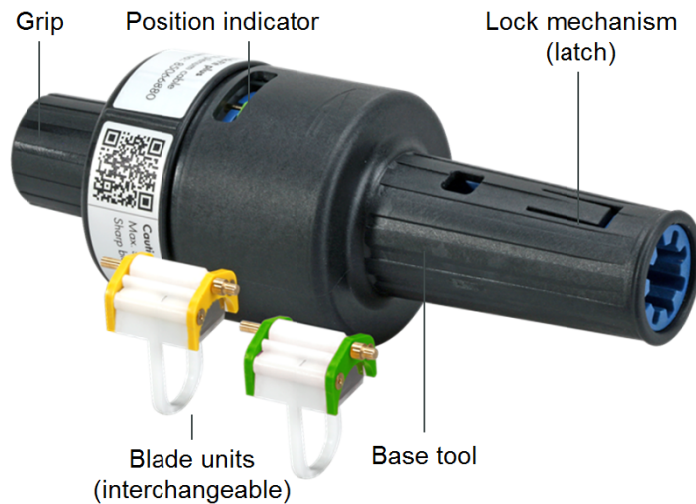

Required Tools



1x screwdriver

1 Verify change position

Make sure that the preparing tool is in the START/END position. If not, then keep the grip fix and rotate the base tool clockwise or counter-clockwise until the START/END position is reached.



2 Separate base tool / grip section

Release the lock-mechanism (latch) at the preparing tool carefully by using a screw-driver and remove the base tool part at once.



Preparing tool 74_Z-0-12-18 for 1/2" annular plenum cables

3 Access blade unit position

This position provides easy access to the blade unit section for inspection, maintenance and replacement purposes.



4 Remove blade unit

Raise carefully the blade unit by means of a fitting screw-driver. Remove the blade unit.

⚠ Blades are fully accessible.



5 Insert blade unit

Insert / re-insert / replace the required blade unit carefully in the correct position.

⚠ Blades are fully accessible.




6 Check position of blade unit

Make sure that the blade unit is properly inserted again and in the final stop position.



7 Assemble base tool

Join the base tool part with the grip part in the correct position. If required, turn the base tool part a little in radial direction until the axial position allows the complete joining.

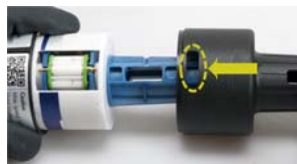

8 Lock base tool

Make sure that the base tool part reached the final position and the lock-mechanism (latch) is locked properly. Check by means of a slight counter-movement.



For assembly instruction with full product range, please visit –
www.hubersuhner.com/QuickFitPlus